



404847 OPTION-EZ3 SERIAL PORT J905

Contains: 404381 circuit board with 403797 harness and keyceptacle; hardware.



Instructions:


1. Remove back cover of the indicator. Unplug beeper.



2. Cut holes for J905 connector in the bottom overlay.




- 3.
4. Remove screws from Main circuit board and existing Option circuit board.

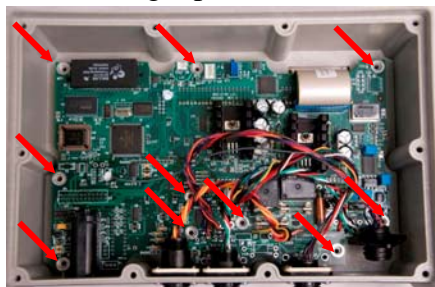


5. Move circuit boards up slightly to allow the Datakey keyceptacle to clear the housing.



6. Remove the existing Option circuit board.
7. Attach harness to bottom of housing with screws and screw plate. Check that connector is oriented correctly.

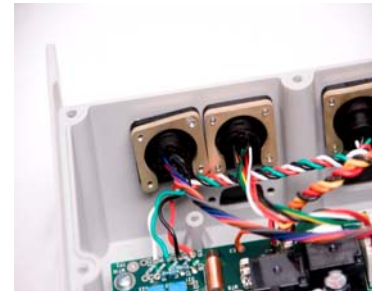


8. Place new Option circuit board in housing while connecting P1 to J1 on the Main circuit board.

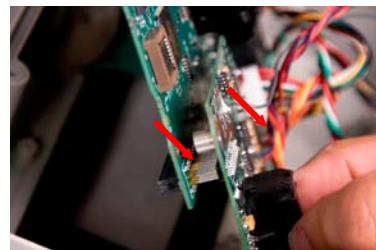



404847 OPTION-EZ3 SERIAL PORT J905 (Continued)

9. Move circuit boards back into position in the housing, lining up the Datakey keyceptacle with the housing. Attach circuit boards to the housing with screws.

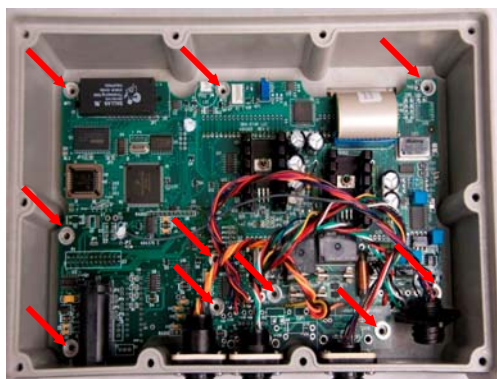

10. Reconnect beeper. Match locking tab.



11. Re-attach rear cover.
12. Change indicator settings to enable the serial port.