




## 404851 OPTION-EZ3 ANALOG OUT

Contains: 404381 circuit board with analog components, hardware.



### Instructions:

1. Remove back cover of the indicator. Unplug beeper.

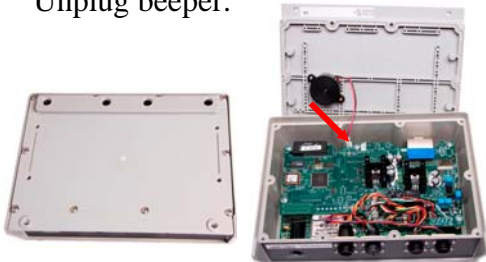



2. Cut holes for J904 connector in the bottom overlay.



3. Label connector location with decal.
4. Attach harness to bottom of housing with screws and screw plate. Check that connector is oriented correctly.



5. Place Option circuit board in housing while connecting P1 to J1 on the Main circuit board (see diagram). Attach to the housing with screws.

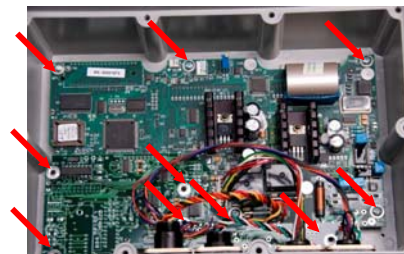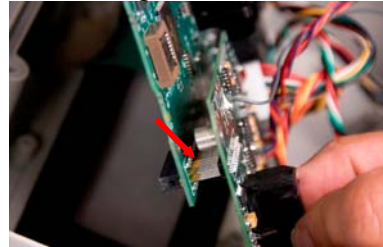

6. Reconnect beeper. Match locking tab.



7. Re-attach rear cover.
8. Change indicator settings to enable and set up the analog output.
9. Enable and calibrate analog output if needed per analog manual.

